


Introduction

Parallel Action Hand Tool CAT-HT-1145-2830-12 was designed to crimp TC145 (P1PD/P1PDT Series) contacts onto 28 & 30 AWG Wire.


This tool should only be used for the contacts and wire gauges specified on this document. The tool is not adjustable. Variation in production batches of tools, connectors, wire stranding, and insulation types may affect crimp parameters. This tool is intended for conductor sizes listed on this document. The tool may not give a good insulation crimp support for all wire insulation sizes of the same wire gauge.

Crimping Procedure

1. This tool can accept contacts directly from a reel; however, if strips are preferred, Samtec recommends using ~6" strips.
2. Squeeze the handles until the tool ratchet releases, allowing the handles to fully open (Figure 1).
3. Slide the contact carrier strip under the contact holder plate and align the carrier strip feed holes with the locating ball detent features. The contact should now be properly positioned and ready to crimp (Figure 2).
4. Partially close the hand tool until you engage the first click of the ratchet.
5. Insert a pre-stripped wire over the contact crimp barrels; align the wire in the groove on the locator plate.

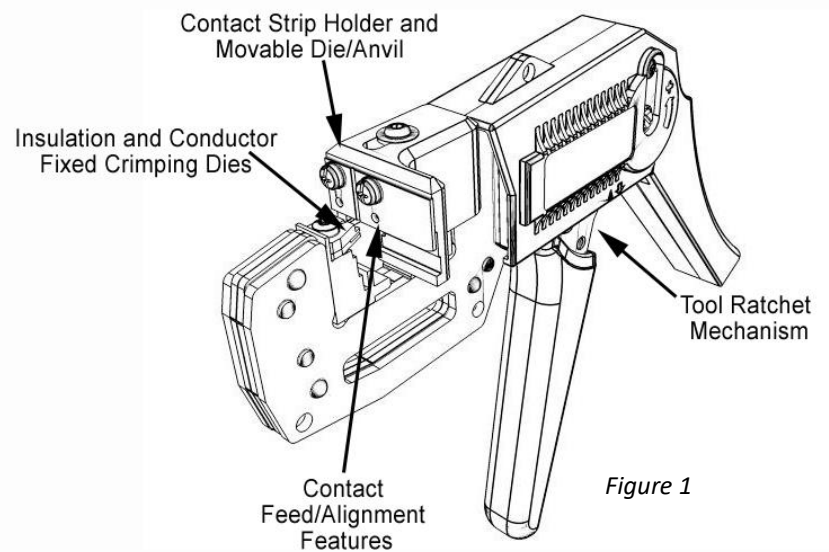

Align carrier strip feed holes with locating ball detent feature

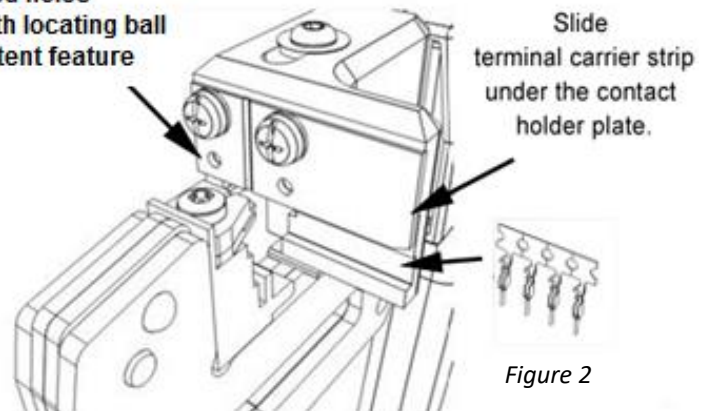

6. Close the handles together until the ratchet mechanism has completed the cycle and the handles release to the fully opened position.
7. Remove the crimped contact from the tool.
8. Manually feed the strip to locate the next contact for crimping.

CAUTION: Should a contact become stuck or jammed in a partially closed position, DO NOT use force to open or close the handles. The tool will easily open by pushing the ratchet release lever up (Figure 3).

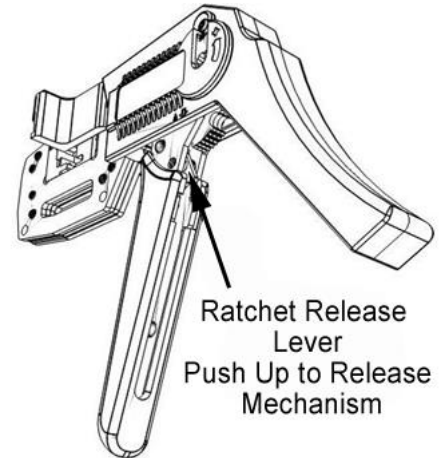


Figure 3

Tool Maintenance

It is recommended that each operator of the tool be made aware of, and be responsible for, following these maintenance steps:

- The tool was engineered for durability, however; for maximum service life and trouble free crimping, establish a good process of scheduled maintenance and lubrication.
- Remove dust, moisture, and other contaminants, with a clean brush or soft lint-free cloth ONLY.
- Make certain all pins, pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do NOT oil excessively (Figure 4).
- Wipe excess oil from the hand tool, particularly from the crimping area.
- It is recommended to use light oil on all pivot points every 5000 crimps, or every 3 months, whichever occurs first.
- When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping area.
- Store the tool in a clean dry place.

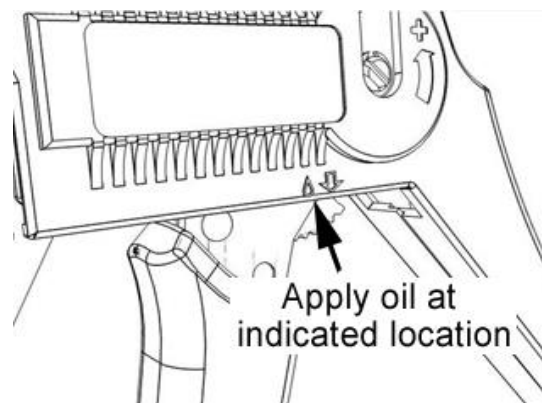


Figure 4



Parallel Action Hand Tool
CAT-HT-1145-2830-12

Instruction Sheet
STS-M-1145-2830-12
Rev. A
Date: 12/8/2023

Tool Dimensions (Figure 5)

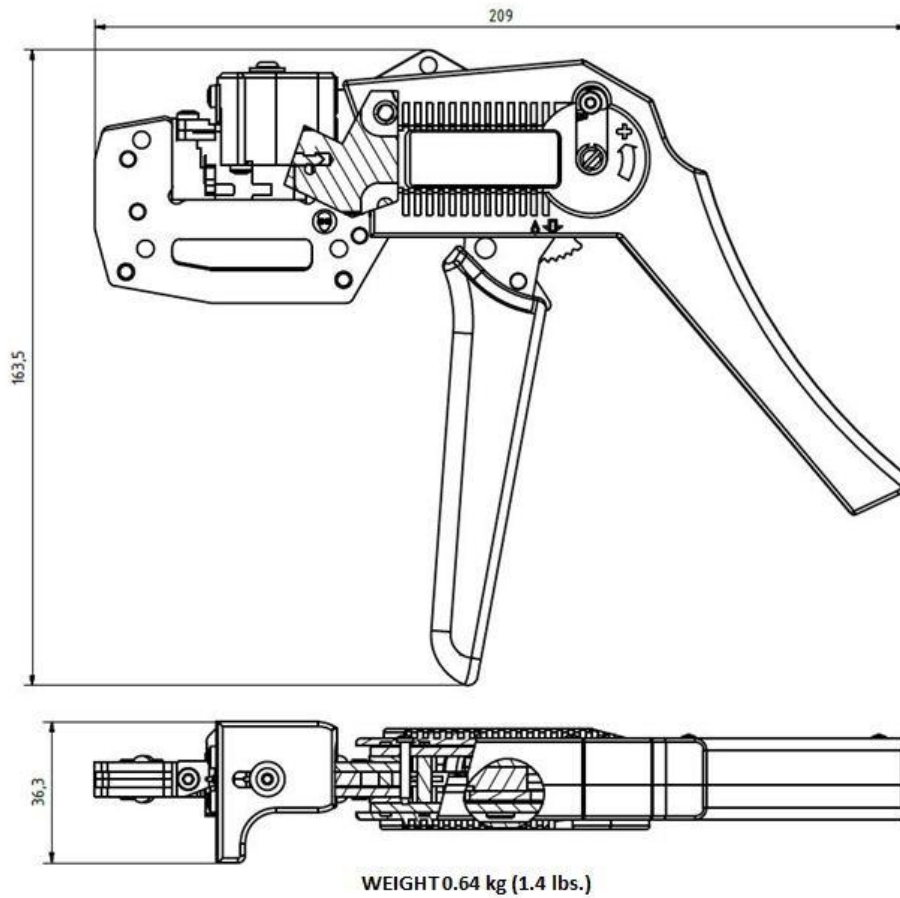


Figure 5